JL Home Inspection Home Inspection Report

JL Home Inspection LLC



123 Easy Street, Nice Town IL Inspection prepared for: Customer Inspection Date: 10/28/2009 Time: 8:30 AM

Inspector: James Langworthy License #450000288 7433 Wilson Terrace, Morton Grove, IL, 60053 Phone: 847-501-0721 Fax: 847-965-1829

Email: jim@jlhomeinspection.com www.jlhomeinspection.com

General Information

We appreciate the opportunity to conduct this inspection for you! Please carefully read your entire Inspection Report. Call us after you have reviewed your report, so we can go over any questions you may have. Remember, when the inspection is completed and the report is delivered, we are still available to you for any questions you may have, throughout the entire closing process. Properties being inspected do not "Pass" or "Fail." - The following report is based on an inspection of the visible portion of the structure; inspection may be limited by vegetation and possessions. Depending upon the age of the property, some items like GFI outlets may not be installed; this report will focus on safety and function, not current code. This report identifies specific noncode, non-cosmetic concerns that the inspector feels may need further investigation or repair. Note that this report is a snapshot in time. We recommend that you or your representative carry out a final walk-through inspection immediately before closing to check the condition of the property, using this report as a guide.

Good Fair Poor Not None Inspec

1. Inspector

Jim Langworthy • Inspector License #450000288 Entity License # 451000321 • www.jlhomeinspection.com • jim@jlhomeinspection.com • 847 501 0721

2. Persons in Attendance

Buyers • Buyers Agent • Sellers

3. Occupancy

The property is occupied.

4. Property Information

This house faces east. • This is a single family home • Brick • This is a two flat.

- 5. Levels
- 2 Story
- 6. Estimated Age

This home is approximately 50 + years old

7. Weather conditions

Temperature at the time of inspection was approximately 47 degrees. • Soil Condition Wet • Time In 8:30 AM • Time Out 11:30 AM • Report # tstevenson10252009 • Light rain. • All utilities were ON at time of inspection

Exterior

Grading and drainage are probably the most significant aspects of a property, simply because of the direct and indirect damage that moisture can have on structures. More damage has probably resulted from moisture and expansive soils than from most natural disasters. Also, there should be gutters and downspouts with splash blocks that discharge away from the building. We have discovered evidence of moisture intrusion inside structures when it was raining that would not have been apparent otherwise. In addition, we recommend that downspouts do not terminate over paved areas such as walks or driveways, as they can contribute to icy slip and fall hazards in winter.

Page 1 of 33

Minor settlement or "hairline" cracks in drives, walks or even foundations are are normal to properties of any age. They should, however, be monitored for expansion and sealed as necessary. Note that any siding, but especially composition or hardboard siding must be closely monitored. Even

modern composition siding and, especially, trim, is particularly vulnerable to moisture damage. All seams be must remain sealed and paint must be applied periodically (especially the lower courses at ground level). It is imperative that continued moisture be kept from it, especially from sprinklers, rain splash back or wet grass. Swelling and deterioration may otherwise result.

Vegetation too close to the home can contribute to damage through root damage to the foundation, branches abrading the roof and siding, and leaves providing a pathway for moisture and insects into the home.

Although rails are not required around drop-offs less than 30", consider your own personal needs and those of your family and guests. By today's standards, spindles at decks and steps should be spaced no more than 4" apart for the safety of children.

Open window wells should have either grates or, preferably, a weatherproof shield installed over them. This will keep rain and snow from building up inside the well and possibly leaking into the home, as well as minimizing your liability from children and non-residents falling inside them. An egress ladder should also be installed within the well, especially at below-grade bedrooms.

Good	Fair	Poor	Not Inspec ted	None	
				X	1. Driveway Condition
	X				2. Walkway Conditions
					Materials: Concrete

Materials: Concrete Observations:

- Cracks and heaved/settled areas observed by front door. Eventual replacement is recommended
- \bullet Recommend sealing all concrete where it meets the building / foundation to prevent water seepage.
- Whenever three or more stairs are present a handrail is usually required. (rear stairs)



Cracks and heaved/settled areas observed by front door. Eventual replacement is recommended



Whenever three or more stairs are present a handrail is usually required. (rear stairs)

		<					3. Exterior Wall Cladding Condition
--	--	---	--	--	--	--	-------------------------------------

Materials: **Brick** Observations:

- Suggest sealing/caulking as part of routine maintenance at all penetrations through the walls.
- Missing/Deteriorated mortar observed, suggest tuckpointing as necessary.
- Suggest trimming back vegetation / trees from house / roof to prevent damage.
- Caulking of siding and windows at cracks, crevices, any openings, penetrations is needed on all windows and doors
- Evidence of past repair on brick (step cracking). Appears to be servicable.
- Some brick windows sills are pitched toward the house allowing water to pool and possible water intrusion into the walls



Suggest sealing/caulking as part of routine maintenance at all penetrations through the walls.



Some brick windows sills are pitched toward the house allowing water to pool and possible water intrusion into the walls



Missing/Deteriorated mortar observed, suggest tuckpointing as necessary.



Caulking of siding and windows at cracks, crevices, any openings, penetrations is needed on all windows and doors

☐ X ☐ 4. Trim Conditions
Materials: Vinyl and Metal Observations: • Loose trim cladding observed, suggest securing as necessary. • Split Caulking and peeling paint noted. • Suggest caulking around doors and windows as necessary.
Loose trim cladding observed, suggest securing as necessary. S. Window/Frame Conditions
Materials: Double Hung • Thermal Pane • Slider • Vinyl Frame • Metal Ca
X
Materials: Wood • Metal Clad Observations: • Front door sticks (1st floor unit). Sand, adjust as needed.
X 7. Gutter Condition
Materials: Aluminum Observations: • Suggest installation of splashblocks/extenders at all downspouts to divert water away from the structure and ensure proper drainage. • Some downspout extenders are damaged and need replacement
X S. Electric/ Gas Meter Condition

9. Electrical Conditions

- Outdoor lighting acceptable/ motion & photocell activated
- GFCI did not respond to test, suggest replacing for safety. Front electrical outlets by door.



GFCI did not res	spond to test, suggest replacing for safety. Front electrical outlets by door.
	10. Exterior Faucet Conditions
	Location: Right Side Observations: • Suggest installing frost proof hose bibs, to prevent the possibility of the water freezing. • Acceptable • Caulk / seal around hose bib • FYI Shut water in the winter time to prevent freezing of pipes
$X \square \square \square$	11. Lot Grade and Drainage Conditions
	12. Retaining Wall Conditions
	13. Patio Conditions
	Materials: Concrete Observations: • Typical cracking observed.
	14. Gereral Exterior Comments
	Observations: • An effective water management program is required for all homes. This includes maintenance / painting of all wood components, caulking of all openings and ongoing vigilance of water handling systems, roof and flashings. Buyer is advised that there was not any evidence of water intrusion into structure at time of inspection unless otherwise noted
	Structure / Basement / Crawl

Page 5 of 33

Customer	123 Easy Street, Nice Town, IL
$X \square \square \square$	1. Foundation Conditions
	Type: Concrete • Partially Finished Observations: • Concrete. • No evidence of water seepage. No visible cracks in the foundation
	 2. Support Post Comments Observations: • Inaccessible. • Posts are finished or concealed, unable to inspect.
	3. Beams Condition
	Materials: Steel Observations: • Beams are partially finished, unable to fully inspect. • The 1st floor is sagging in hallway by the bathroom. Master bedroom doors have large gaps on one side. Recommend further evaluation from a contractor or structural engineer.
The 1st floor is sagging side. Reco	ng in hallway by the bathroom. Master bedroom doors have large gaps on one ommend further evaluation from a contractor or structural engineer.
	4. Joist Sub floor Condition
	Materials: Dimensional wood Framing
$X \square \square \square \square$	5. Basement Stairs Condition Observations:
	• Hand/Guardrail is loose/ missing. Recommend repair as necessary for safety. (basement)



Hand/Guardrail is	s loose/ missing. Recommend repair as necessary for safety. (basement)
\times \square \square \square	6. Basement Floor Condition
	Materials: Carpet Observations: • Dry at time of inspection.
$X \square \square \square$	7. Basement Walls Condition
	Materials: Drywall
$X \square \square \square$	8. Basement Ceilings Condition
	Materials: Drywall
$X \square \square \square$	9. Window Condition
	Style: Glass Block
	10. Electrical Conditions
	Observations: • Observed open electrical boxes. "Safe off" wires and install covers/ wallplates.
	11. Distribution/Ducts
	Pipes/Radiators Observations: • There is electric heat in one room in basement. Electrical outlets need to have 24" clearance above electric heat units. Remove outlet

Customer		1.	23 Easy Street, Nice Town, I
	within the scope of Home In	spection. If buyer esence of mold, he/	areas of the home does NOT fall has concerns about mold due to she is advised to consult with a to carry out destructive
	Air Con	ditioning	
climate control system comfortable level while a minimum. The HVAO powered by other sou unit was NOT tested if	n for the structure. The goal of the maintaining indoor air quand containing indoor air quand contained as butane, oil, properties such as butane, oil, properties are such as butane, oil, properties are such as butane.	of these systems lity, ventilation wh d by electricity and opane, solar panel	iten referred to as HVAC) is the is to keep the occupants at a ile keeping maintenance costs at I natural gas. but can also be s, or wood. The air conditioning ees. Operating system below 60
For a more thorough i Units functioned at tim		lease contact a lic	the thermostat or other controls. censed HVAC service person.
	1. Air Conditioning Comme	nts	
combustion of any fue What are the sympton Symptoms are often conset of the heating so following symptoms, conset the symptoms are often conset of the heating symptoms, conset the symptoms are symptoms.	el, including gasoline, oil, proms of carbon monoxide poiso confused with those of the flue eason - or during the flue se or only one or a few of these by * Dizziness * Weakness *	ppane, natural gas pning? u, and most cases ason. A victim ma symptoms: Visual disturbance	s. It is caused by the incomplete wood or coal. of CO poisoning occur at the ay not experience ANY of the e * Nausea * Vomiting * Fainting the heart * Confusion * Cherry red
High levels of carbon * A malfunctioning hea * A blocked chimney of * Heating equipment theating system to add * A tightly sealed, ove * An exhaust fan in an Potentially dangerous the chimney. * A barbecue grill used * A natural gas or prop * Running a car in an angerous	I living space. I insulated home that lacks partice of loft that continues to combustion gases can be do indoors. I indoors. I pane range that is used to he	by: on propane, natura nt pipe. Ited. This can be a proper ventilation. Iten when doors Irawn into the home.	a problem if you enclose your and windows are closed. ne instead of escaping through
indoors without proper Keep in mind, though, CO outside the home.	r`ventilation. , that the level of carbon mor . This means that if you live on n your home than someone l	noxide in the hom on a street with a living in a low-traff	e is directly related to the level of lot of traffic, you are likely to have
ames Langworthy	Page	e 8 of 33	JL Home Inspection

What warning signs in the home can alert you to the presence of high levels of carbon monoxide?

- * Stuffy, stale or smelly air.
- * Very high humidity.
- * Fallen soot from a fireplace or heating system.
- * No draft in your chimney or a hot draft backing out of the heating system and into the basement or house.
- * Flue like symptoms that disappear when you spend time outside your home.

What measures can I take to lessen the chance of carbon monoxide poisoning?

- * Install carbon monoxide detectors.
- * Check your heating system and chimney every autumn for blockage.
- * Have your heating system "tuned-up" (preferably before the heating season begins) to ensure it's in good working order.
- * Periodically check your heating system for hot drafts backing out of the burner.
- * Have your appliances checked periodically to make sure they're working properly.
- * If you have insulated your home, had major renovations done, or enclosed your heating system to increase living space, make sure there is adequate ventilation.
- * Use appliances properly don't use barbecue grills indoors, don't use your stove / oven for heat, and don't run a vehicle in a closed garage.
- * Don't repair lawn mowers, snow blowers or vehicles indoors without proper ventilation.
- * Have your vehicle's muffler and tailpipes inspected regularly for CO leaks.

What should you do if you suspect the presence of high levels of CO in your home?

* Open the windows and doors.

Not

None

- * Call your heating fuel supplier or a licensed heating contractor for an emergency inspection.
- * If carbon monoxide is detected, seek medical attention immediately. What's the cure for CO poisoning?
- * Exposure to fresh air or pure oxygen is the cure.

Heating

1. Heating Deficiencies
Materials: Typical life expectancy is approximately 20 yrs • Approximate age 20+ years • Brand Broman • Boiler is Gas Hot Water Observations: Functioned at time of inspection • Recommend having furnaces cleaned and checked once a year. • The presence of dirt, or yellow flame indicates improper combustion may be occurring with this appliance. Further review by a licensed heating contractor is recommended. • I estimate the boiler is at least 20- 30 years old. Past its expected life. Expect maintenance /replacement.

Good Fair Poor

James Langworthy

Page 10 of 33

Materials: Drywall • Plaster

Common cracks noted.

Observations:

Customer	123 Easy Street, Nice Town, 1L
x 🗌 🗎 🗎	3. Ceiling Conditions Materials: Drywall/Plaster Observations:
	 Common cracks noted. Dry at the time of the inspection. 4. Kitchen Windows Condition
	Style: Double Hung • Single pane Observations: • Deterioration of wooden frames noted. While basic maintenance may prolong the life of these window frames, replacement may be necessary at some point.
	5. Kitchen Electrical Condition
	Observations: • A representative amount of electrical outlets were inspected • The GFCI outlets and switches are loose in the (countertop) wall. Secure adequately
	6. Kitchen Cabinet Condition
	Observations:
	Wood Cabinets
	Doors are out of alignment.
	Noted wear expected for age of cabinets
$X \square \square \square$	7. Kitchen Counter Top Condition
	Observations: • Laminate • Suggest caulking at backsplash as necessary.
	8. Kitchen Sink Condition Materials: Porcelain
$X \cap A \cap A$	9. Kitchen Faucets
	Observations: • Faucet is loose. basement



Faucet is loose, basement

 $|\chi|$ | | | | | 10. Traps/Drains/Suply Condition

Observations:

• Drain trap is at term life, replace trap assembly





Drain trap is at term life, replace trap assembly


Drain trap is at term life, replace trap assembly

X 11. Stove Cookt

11. Stove Cooktop Oven Conditions

Style: Natural Gas Observations:

- Recommend replacing all flexible gas lines every 4 -8 years
- Functioned at time of inspection
- Gas valve missing at gas service pipe (2nd floor). Manual gas shut off valve required at each appliance.

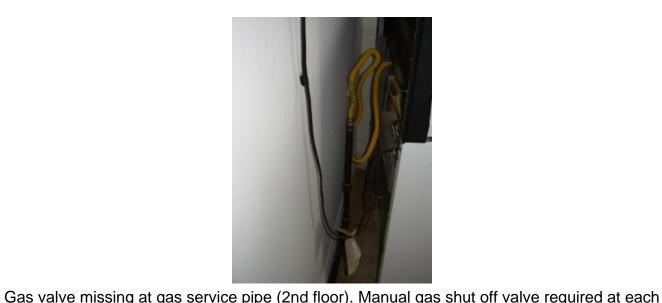

	appliance.
	12. GarbageDisposal
	Observations: • Garbage disposal is noisy. Repair / replace as needed
$X \square \square \square$	13. Dishwasher Condition
	Observations: • Functioned at time of inspection.
$X \square \square \square$	14. Hood Fan Condition
	Recirculating Observations: • Functioned at time of inspection.
	Electrical Panel
Good Fair Poor Not None Inspec ted	
X	1. Main Service Drop Condition
	Type: Main Service Drop is overhead. • Panel Location Basement

	X				2. Electrical	panel	Condition
--	---	--	--	--	---------------	-------	-----------

Type / Materials: Breakers • Seimens • Service entrance cables are copper • Branch circuit wiring is copper • Conduit is present • BX / greenfield is present

• 2 electrical panels, one for each floor Observations:

- Overload protection provided by breakers.
- The main service is approximately 100 amps, 220 volts.
- Main disconnects are present.
- Open positions observed for future expansion.
- Ground wire observed at main water shutoff / meter
- AFCI protection in bedroom branch circuits in a new requirement, not present in this house. Recommend installing Arc Fault breakers
- There are three 20 amp circuit breakers with 14 gauge wires. Either install a 15 amp breaker or replace ALL 14 gauge wire with 12 gauge wire.1st floor
- Circuit breakers are not labeled on index, label all breakers
- Both electrical panel covers need to be flush with panel (no space between cover and breakers) Replace all screws, screws need to be without a point on the end and not excessively long



There are three 20 amp circuit breakers with 14 gauge wires. Either install a 15 amp breaker replace ALL 14 gauge wire with 12 gauge wire.1st floor panel	or
3. Sub Panel comments	
4. Smoke detector comments	
Observations: • Suggest new smoke detectors and Carbon monoxide detectors. These detectors are a maximum life of 7-10 years. Change batteries twice annually. Install	

rs all bedrooms, stairways, hallways, kitchens, install according to manufacturers recommendations. Recommend fire extinguishers in all kitchens and utility rooms, garages. Carbon monoxide detectors are required within 15 feet of bedrooms.

Plumbing			
Good Fair Poor Not None Inspec ted			
\times \square \square \square	1. Main Shutoff Deficiencies		
	Materials: Lead • Public supply • Utility Room Observations: • Electrical ground wire in place at meter.		
\times \square \square \square	2. Supply Line Condition		
	Materials: Galvanized and Copper Observations: • Adequate water pressure at time of inspection. • Galvanized supply lines were noted. This was common plumbing at time of construction. Due to nature of galvanized piping, Expect / recommend replacement		
$X \cap Y \cap Y$	3. Waste/ Venting Line Condition		
	Materials: Public Waste • Galvanized • PVC • Cast Iron vent piping		
	4. Sump Pump Conditions		
	5. Ejector Pump Conditions		
	6. Plumbing Comments		
	Comments: • Hot water should not exceed 120 degrees. Scalding can occur. Suggest buying anti-scald faucets when faucets are replaced.		
	Water Heater		
Good Fair Poor Not None Inspec ted			
X	1. Water heater conditions		
	Materials: Brand GE • Approximate Age 4-2004 • Model # GG75T06ANF00 • Serial # GELN0404106001 • Capacity 75 gallons • Typical life expectancy is 6-12 years Observations: Functioned at time of inspection		
$X \square \square \square \square$	2. Supply lines Condition		
	Materials: Copper • Galvanized		
x	3. Temperature Pressure Release Valve Conditions		

X				
	Materials: Metal			
Bedrooms, Kitchen or hallways, foyer, and of	Other Interior Areas vers areas of the house that are not considered part of the Bathrooms, areas covered elsewhere in the report. Interior areas usually consist of the open areas. Within these areas the inspector is performing a visual ort visible damage, wear and tear, and moisture problems if seen. Personal			
	may prevent the inspector from viewing all areas on the interior.			
	t test for mold, radon, asbestos or other hazardous materials. A qualified ulted if you would like further testing.			
$X \square \square \square$	1. Floor Condition			
	Observations: • hardwood • Carpet			
$X \square \square \square$	2. Wall Condition			
	Observations: • Drywall / plaster • Common cracks noted.			
$X \square \square \square$	3. Ceiling Conditions			
	Observations: • Drywall / plaster • Common cracks noted. • Dry at the time of the inspection.			
$X \square \square \square$	4. Door Conditions			
	Observations: • Panel			
	5. Window Condition			
	Observations: • Thermal Pane • Double Hung • Slider • A representative amount of windows were inspected • Weatherstripping has come loose on bottom of windows, repair / replace as needed.			

Customer

123 Easy Street, Nice Town, IL



Weatherstrip	oing has come loose on bottom of windows, repair / replace as needed.
	6. Electrical Conditions
	Observations:

• repair / Replace wobbly ceiling fan in the living room



X 7. Stair Condition	Remove electrical outlet tions
	Garage

None

Customer	123 Easy Street, Nice Town, II
	1. Garage Conditions
	Materials: Detached • Frame construction • Vinyl Siding • Asphalt Comp.
	Shingles Observations: There is minor damage to the exterior cladding of the garage, repair as needed • The siding has ground contact and has rotted bottom row of siding • Fascia boards are rotted, replace all fascia boards
$X \square \square \square$	2. Garage Floor Condition
	Materials: Concrete Observations: • Typical cracks noted for age of garage. • Evidence of past water penetration observed. Garage is below grade, water coming in from the corner at alley.
\square \square \square \square	3. Garage Door Condition
	Materials: Metal
\times \square \square \square	4. Garage Door Opener Condition
	Observations: • Safety reverse in place and operational
\times \square \square \square	5. Exterior / Fire Door Condition
	Materials: Metal/Metal Clad
\times \square \square \square	6. Garage Wall & Firewalls Condition
	Materials: Unfinished • Wood
	7. Garage Celing Condition
	Materials: Unfinished • Wood Observations:
	• Evidence of water penetration observed and roof sheathing is rotted.



	ence of water penetration observed and roof sheathing is rotted.
	8. Garage Electrical Condition

- Loose electrical box and cover, secure as needed
- Recommend installing a GFCI electrical outlet, any outlet in garage, on the exterior or within six feet of water should be a GFCI type.
- Open junction boxes were observed. Secure wires and install covers



Recommend installing a GFCI electrical outlet, any outlet in garage, on the exterior or within six feet of water should be a GFCI type.



Open junction boxes were observed. Secure wires and install covers

9. Garage Roof Condition

Materials: Asphalt Composition Shingles Observations:

• Roof is leaking. Replace roof



Roof is leaking. Replace roof

Attic / Ventilation

Good	ıaıı	F 001	Inspec	None	
					1. Methods Used to Inspect
					How Inspected: Accessible • Scuttle hole
X					2. Framing Condition
					Style: Truss • Dimensional wood
X					3. Sheathing Condition
					Materials: Dimensional wood Observations:

• Light shows through the plumbing vents which may indicate a leak. Repair flashing



Light shows through the plumbing vents which may indicate a leak. Repair flashing

2. Firepalce Style

Style: Wood burning

	X			3. Firepalce Coments
--	---	--	--	----------------------

- A wood burning fireplace is noted in this home. It is strongly suggested that this fireplace be cleaned and inspected every 1 to 2 years depending on usage.
- It is recommended that you have a qualified chimney sweep perform a Level II inspection before using the fireplace, and that you have the chimney inspected and cleaned yearly. The sweep can install flue caps and a spark barrier if needed.
- Recommend chimney cleaning annually or every other year depending on usage. Creosote buildup can cause a fire in the chimney.
- Missing mortar between bricks inside chimney, repair as needed.
- Large gap between interior wall and fireplace smoke chamber, further review is needed. Recommend not using fireplace until it is serviced



It is recommended that you have a qualified chimney sweep perform a Level II inspection before using the fireplace, and that you have the chimney inspected and cleaned yearly. The sweep can install flue caps and a spark barrier if needed.

Bathrooms can consist of many features from jacuzzi tubs and showers to toilets and bidets. Because of all the plumbing involved it is an important area of the house to look over. Moisture in the air and leaks can cause mildew, wallpaper and paint to peel, and other problems. The home inspector will identify as many issues as possible but some problems may be undetectable due to problems within the walls or under the flooring..

Customer	123 Easy Street, Nice Town, 11
x 🗌 🗎 🗆	3. Bathroom Wall Condition
\times \square \square \square	Materials: drywall 4. Bathroom Ceiling Condition
	Materials: Drywall Observations: • Dry at the time of the inspection.
$X \square \square \square \square$	5. Bathroom Doors Condition
	Materials: Panel
$X \square \square \square$	6. Bathroom Windows Condition
	Style: Double Hung • Thermal pane
$X \square \square \square$	7. Electrical Condition
	Observations: • GFCI in place and operational
$X \square \square \square$	8. Source Condition
	Type: Central Heating Observations: • We recommend an exhaust fan be installed in all bathrooms for proper ventilation and moisture control.
$X \square \square \square \square$	9. Shower Condition
	Materials: Ceramic tile • Fiberglass / Tub surround Observations: • Caulking is needed at perimeter of the tub, all corners and the tub spout, faucet handles. (All bathrooms)
	• Slow tub drain 1st floor



Caulking is needed	d at perimeter of the tub, all corners and the tub spout, faucet handles. (All bathrooms)
$X \square \square \square$	10. Tub / Shower Faucet Condition
	Observations: • Shower/ tub diverter does not fully engage. Repair / replace as needed. 2nd floor • Slow drain on sink.(basement & 2nd floor) Clean / rod as needed
$X \square \square \square$	11. Sink / Faucet Cabinet Condition
	Materials: Sink acceptable • Cabinets are wood • Cabinets are acceptable • Suggest caulking all backsplashes at walls. • Faucet acceptable
	12. Traps/Drains/Supply Condition
	Observations: • Recommend trap assembly for repair or replacement. (1st & 2nd floor)



Recommend trap assembly for repair or replacement. (1st & 2nd floor)



Recommend trap assembly for repair or replacement. (1st & 2nd floor)

• Panel

$X \square \square \square$	5. Window Condition
	Observations: • Thermal Pane • Double Hung
	6. Electrical Conditions

- A representative amount of electrical outlets were inspected
- 1st master bedroom has a "dead" electrical outlet, repair as needed.
- In some bedrooms (2nd floor), there are not enough electrical outlets. Not required when home was built. Current standard is 1 outlet every 6 feet



1st master bedroom has a "dead" electrical outlet, repair as needed.

Observations: 1st floor bedroom has loose hinge on closet door, repair as needed. • 2nd floor closets have a small window, older wood single pane windows, recommend replacement



2nd floor closets have a small window, older wood single pane windows, recommend replacement

_		
\Box	_	_ 1
$\boldsymbol{\sim}$	$\boldsymbol{\cap}$	വ
1	w	w

Good Fair Poor Not None Inspec

1. Methods Used to Inspect Roof

How Inspected: Visually accessible from ground. • Visually accessible from ground. Not mounted due to height and pitch.

X 2. Roof Condition

Materials: Asphalt Composition Shingles Observations:

- Suggest trimming all trees and vegetation away from roof to prevent damage to roofing materials.
- No staining observed inside on ceiling and/ or attic
- Typically roof life expectancy is approximately 20 years
- Some shingles have damage or have blown off. The roof is past its expected life. Recommend replacement



Laundry Area

Good Fair Poor Not None Inspec ted	
	1. Laundry Area Location
	Location: Basement
	2. Floors Meteriole: Coromic Tile
	Materials: Ceramic Tile
	3. Walls Condition Materials: Concrete
	4. Ceiling Condition
	Materials: Unfinished • Wood
	5. Window Condition
	Materials: Glass Block
	6. Laundry Tub/Sink Condition
$X \square \square \square$	7. Laundry Faucets
\times \square \square \square	8. Electrical Conditions
$X \cap Y \cap Y$	9. Washer Hook-ups
	Observations: • Washer electric is acceptable • Hose bib connection acceptable • Washer drained into open drain • The water hoses for the washer should be replaced every 7-10 years and consider "break away" hoses to prevent flooding. • No leaks at time of inspection
$X \square \square \square$	10. Dryer Hook-ups
	Observations: • Gas • Functioned at time of inspection • Dryer electric is acceptable • Dryer gas line acceptable • Recommend replacing all flexible gas lines every 4 -8 years • Dryer vent hose should be solid metal type. Plastic could burn and foil corrugated type clog easily.



Dryer vent hose should be solid metal type. Plastic could burn and foil corrugated type clog easily.

Report Summary

On this page you will find, in **RED**, a brief summary of any **CRITICAL** concerns of the inspection, as they relate to Safety and Function. Examples would be bare electrical wires, or active drain leaks. The complete list of items noted is found throughout the body of the report, including Normal Maintenance items. Be sure to read your entire report!

For your safety and liability, we recommend that you hire only licensed contractors when having any work done. If the living area has been remodeled or part of an addition, we recommend that you verify the permit and certificate of occupancy. This is important because our inspection does not tacitly approve, endorse, or guarantee the integrity of any work that was done without a permit, and latent defects could exist.

Depending upon your needs and those who will be on this property, items listed in the body of the report may also be a concern for you; be sure to read your Inspection Report in its entirety.

Note: If there are no comments in RED below, there were no CRITICAL system or safety concerns with this property at the time of inspection.

Exterior		
Page 2 Item: 2	Walkway Conditions	 Cracks and heaved/settled areas observed by front door. Eventual replacement is recommended Recommend sealing all concrete where it meets the building / foundation to prevent water seepage. Whenever three or more stairs are present a handrail is usually required. (rear stairs)
Page 3 Item: 3	Exterior Wall Cladding Condition	 Missing/Deteriorated mortar observed, suggest tuckpointing as necessary. Suggest trimming back vegetation / trees from house / roof to prevent damage. Caulking of siding and windows at cracks, crevices, any openings, penetrations is needed on all windows and doors Evidence of past repair on brick (step cracking). Appears to be servicable. Some brick windows sills are pitched toward the house allowing water to pool and possible water intrusion into the walls
Page 4 Item: 4	Trim Conditions	 Loose trim cladding observed, suggest securing as necessary. Split Caulking and peeling paint noted. Suggest caulking around doors and windows as necessary.
Page 4 Item: 6	Exterior Door Conditions	• Front door sticks (1st floor unit). Sand, adjust as needed.
Page 4 Item: 7	Gutter Condition	 Suggest installation of splashblocks/extenders at all downspouts to divert water away from the structure and ensure proper drainage. Some downspout extenders are damaged and need replacement
Page 5 Item: 9	Electrical Conditions	• GFCI did not respond to test, suggest replacing for safety. Front electrical outlets by door.
Structure / Baser	nent / Crawl	
Page 6 Item: 3	Beams Condition	• The 1st floor is sagging in hallway by the bathroom. Master bedroom doors have large gaps on one side. Recommend further evaluation from a contractor or structural engineer.
Page 7 Item: 5	Basement Stairs Condition	• Hand/Guardrail is loose/ missing. Recommend repair as necessary for safety. (basement)

Page 7 Item: 10	Electrical Conditions	• Observed open electrical boxes. "Safe off" wires and install covers/ wallplates.	
Page 7 Item: 11	Distribution/Ducts	• There is electric heat in one room in basement. Electrical outlets need to have 24" clearance above electric heat units. Remove outlet	
Heating			
Page 9 Item: 1	Heating Deficiencies	• Recommend having furnaces cleaned and checked once a year. • The presence of dirt, or yellow flame indicates improper combustion may be occurring with this appliance. Further review by a licensed heating contractor is recommended. • I estimate the boiler is at least 20- 30 years old. Past its expected life. Expect maintenance /replacement.	
Page 10 Item: 2	Exhaust Venting Conditions	• Holes/ rust observed in flue vent pipe for boiler, which is a serious safety concern. Replace all flue piping, installed w/ screws in each section.	
Page 10 Item: 4	Thermostat/ Filters Condition	• Suggest replacing the thermostat with a programmable unit to conserve on energy.	
Kitchen			
Page 10 Item: 1	Kitchen Floor Condition	• Many cracked floor tiles noted. 2nd floor	
Page 11 Item: 4	Kitchen Windows Condition	• Deterioration of wooden frames noted. While basic maintenance may prolong the life of these window frames, replacement may be necessary at some point.	
Page 11 Item: 5	Kitchen Electrical Condition	• The GFCI outlets and switches are loose in the (countertop) wall. Secure adequately	
Page 11 Item: 7	Kitchen Counter Top Condition	• Suggest caulking at backsplash as necessary.	
Page 12 Item: 9	Kitchen Faucets	• Faucet is loose. basement	
Page 12 Item: 10	Traps/Drains/Suply Condition	• Drain trap is at term life, replace trap assembly	
Page 13 Item: 11	Stove Cooktop Oven Conditions	• Gas valve missing at gas service pipe (2nd floor). Manual gas shut off valve required at each appliance.	
Page 13 Item: 12	GarbageDisposal	• Garbage disposal is noisy. Repair / replace as needed	
Electrical Panel			
Page 14 Item: 2	Electrical panel Condition	 There are three 20 amp circuit breakers with 14 gauge wires. Either install a 15 amp breaker or replace ALL 14 gauge wire with 12 gauge wire.1st floor panel Circuit breakers are not labeled on index, label all breakers Both electrical panel covers need to be flush with panel (no space between cover and breakers) Replace all screws, screws need to be without a point on the end and not excessively long 	
Page 14 Item: 4	Smoke detector comments	• Suggest new smoke detectors and Carbon monoxide detectors. These detectors have a maximum life of 7-10 years. Change batteries twice annually. Install in all bedrooms, stairways, hallways, kitchens, install according to manufacturers recommendations. Recommend fire extinguishers in all kitchens and utility rooms, garages. Carbon monoxide detectors are required within 15 feet of bedrooms.	
Other Interior Areas			
Page 17 Item: 5	Window Condition	 Weatherstripping has come loose on bottom of windows, repair / replace as needed. 	

Page 17 Item: 6	Electrical Conditions	• repair / Replace wobbly ceiling fan in the living room
Garage		
Page 18 Item: 1	Garage Conditions	• The siding has ground contact and has rotted bottom row of siding • Fascia boards are rotted, replace all fascia boards
Page 18 Item: 2	Garage Floor Condition	• Evidence of past water penetration observed. Garage is below grade, water coming in from the corner at alley.
Page 19 Item: 7	Garage Celing Condition	• Evidence of water penetration observed and roof sheathing is rotted.
Page 19 Item: 8	Garage Electrical Condition	 Loose electrical box and cover, secure as needed Recommend installing a GFCI electrical outlet, any outlet in garage, on the exterior or within six feet of water should be a GFCI type. Open junction boxes were observed. Secure wires and install covers
Page 20 Item: 9	Garage Roof Condition	• Roof is leaking. Replace roof
Attic / Ventilation		
Page 21 Item: 3	Sheathing Condition	• Light shows through the plumbing vents which may indicate a leak. Repair flashing
Page 21 Item: 4	Insulation Condition	• Recommend adding additional insulation to a R value of 30.
Page 21 Item: 5	Ventilation Conditions	• When the house is re roofed, consult with roofer to see if additional static vents should be installed
Page 21 Item: 6	Electrical Conditions	 Missing cover plates observed, suggest installing for safety. Exposed electrical wiring observed. This is a safety concern.
Fireplace		
Page 22 Item: 3	Firepalce Coments	 It is recommended that you have a qualified chimney sweep perform a Level II inspection before using the fireplace, and that you have the chimney inspected and cleaned yearly. The sweep can install flue caps and a spark barrier if needed. Recommend chimney cleaning annually or every other year depending on usage. Creosote buildup can cause a fire in the chimney. Missing mortar between bricks inside chimney, repair as needed. Large gap between interior wall and fireplace smoke chamber, further review is needed. Recommend not using fireplace until it is serviced
Bathroom	T	
Page 23 Item: 8	Source Condition	• We recommend an exhaust fan be installed in all bathrooms for proper ventilation and moisture control.
Page 24 Item: 9	Shower Condition	 Caulking is needed at perimeter of the tub, all corners and the tub spout, faucet handles. (All bathrooms) Slow tub drain 1st floor
Page 24 Item: 10	Tub / Shower Faucet Condition	 Shower/ tub diverter does not fully engage. Repair / replace as needed. 2nd floor Slow drain on sink.(basement & 2nd floor) Clean / rod as needed
Page 25 Item: 12	Traps/Drains/Suppl y Condition	• Recommend trap assembly for repair or replacement. (1st & 2nd floor)

Page 25 Item: 13	Toilet Condition	• The toilet bowl is loose at floor 2nd floor. The wax ring inside the unit must have a snug, secure fit in order to keep from leaking. Properly resealing and re-securing this unit is suggested to prevent water leakage and damage to the sub-floor area. • 1st floor toilet has a "short flush" repair as needed	
Bedroom			
Page 26 Item: 6	Electrical Conditions	 1st master bedroom has a "dead" electrical outlet, repair as needed. In some bedrooms (2nd floor), there are not enough electrical outlets. Not required when home was built. Current standard is 1 outlet every 6 feet 	
Page 27 Item: 7	Closet	• 1st floor bedroom has loose hinge on closet door, repair as needed. • 2nd floor closets have a small window, older wood single pane windows, recommend replacement	
Roof			
Page 27 Item: 2	Roof Condition	• Some shingles have damage or have blown off. The roof is past its expected life. Recommend replacement	
Page 27 Item: 5	Chimney Condition	• Brick and mortar deterioration observed; repair / tuck pointing advised.	
Laundry Area			
Page 29 Item: 10	Dryer Hook-ups	• Dryer vent hose should be solid metal type. Plastic could burn and foil corrugated type clog easily.	